

ULTRASONIC THICKNESS GAUGE TM-8818

1. FEATURES

- * Used the exclusive Micro-computer LSI circuit and crystal time base to offer high accuracy measurement .
- * With high power of emission and broad band of receiving sensitivity, the gauge can match probes of different frequencies. That makes it easy to measure the rough surface, even cast iron. It is widely used in almost all kinds of industries.
- * Applicable to measure the thickness of many materials, e. g. Steel, Cast iron, Aluminum, Red copper, Brass, Zinc, Quartz glass, Polyethylene, PVC, Gray cast iron, Nodular cast iron.
- * Automatic power off to conserve power.
- * Can communicate with PC computer for statistics and printing by the optional cable and the software for RS232C interface .

4. MATERIAL SELECTION

- 4.1 Press the power key 3-5 to turn on the unit.
- 4.2 Press the Material Selection key 3-13 and the display 3-9 will show the code `cdxx` or `xxxx`. `cd` is the abbreviation for `code` and `xx` is one number among 01~11. `xxxx` is a 4-digit number which is the sound velocity of material defined by the user.. The `cdxx`-material relationship is as follow.

| No. | CODE | Material |
|-----|------|--------------|
| 1 | cd01 | Steel |
| 2 | cd02 | Cast Iron |
| 3 | cd03 | Aluminum |
| 4 | cd04 | Red copper |
| 5 | cd05 | Brass |
| 6 | cd06 | Zinc |
| 7 | cd07 | Quartz glass |


2. SPECIFICATIONS

- Display: LCD
 Range: 0.75~400mm (45# steel)
 (Depend on Probe)
 Resolution: 0.1 mm / 0.01mm / 0.001inch
 Accuracy: $\pm (0.5\%n+0.05)$
 Sound velocity: 1000 ~9999 m/s
 With: Bluetooth interface
 Power supply: 2x1.5V AA (UM-3) battery
 Operating condition:
 Temp. 0~40°C
 Humidity <80%
 Size: 130x76x32mm
 Weight: about 340g (not including batteries)
 Accessory:
 Carrying case.....1 pc.
 Operation manual.....1 pc.
 Ultrasonic sensor.....1 pc.
 Optional accessories:
 Cable & software for RS232C

| No. | CODE | Material |
|-----|------|-------------------|
| 8 | cd08 | Polyethylene |
| 9 | cd09 | PVC |
| 10 | cd10 | Gray cast iron |
| 11 | cd11 | Nodular cast iron |
| 12 | xxxx | Sound velocity |

- 4.3 Press the Plus key 3-4 or Minus key 3-11 to select the material code to measure and then press the Material Selection key to confirm. The display will show `0`. If you select a material code but do not confirm the selection, the code will automatically change to `0` after several seconds. In such case, the meter will still reserve the material code before exiting.
- 4.4 A 4-digit number will be shown on the Display. Press the Plus key 3-4 when displaying `cd11` or press the Minus key 3-11 when displaying `cd01`. The 4-digit number is last sound velocity

3. FRONT PANEL DESCRIPTIONS

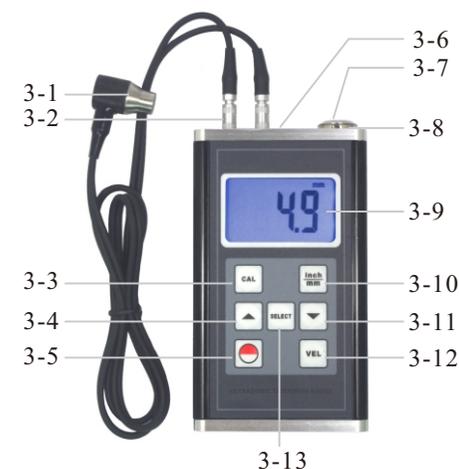

- | | |
|-----------------------|--|
| 3-1 Ultrasonic sensor | 3-8 Battery Cover |
| 3-2 Sensor Plug | 3-9 Display |
| 3-3 Calibration key | 3-10 0.1mm / 0.01mm / 0.001inch conversion key |
| 3-4 Plus key | 3-11 Minus key |
| 3-5 Power key | 3-12 Velocity key |
| 3-6 RS232C interface | 3-13 Material selection key |

to define by the user. By selecting this velocity, you could measure the thickness of the same material as last.

- 4.5 It is unnecessary to select the material code once the material code is confirmed (automatically stored to the memory of the meter) unless the material to measure is different from that before.
- 4.6 To browse the material code selected, if only press the Select key 3-13. To quit browsing, if only press the Select key 3-13 again or wait till the code automatically change to `0` after several seconds or the meter will automatically return to measurement state if measuring.

5. CALIBRATION

- 5.1 Drop a little oil on the 5 mm standard block 3-7 .
- 5.2 Press the Calibration key 3-3, the `CAL` be shown on the Display. `CAL` is the short for calibration.

5.3 Press the sensor 3-1 on the standard block. The coupling symbol ((●)) is on if coupling well. The calibration is completed while a beep sounds.

5.4 The calibration result will be auto-saved to the unit once confirmation. It is unnecessary to calibrate often unless you suspect the accuracy of measurement.

6. MEASURING PROCEDURE

6.1 Press the power key 3-5 to turn on the unit.
6.2 Press the 0.1mm/0.01mm/inch convert key 3-10 to select the right measurement unit and resolution.

6.3 Press the Sensor 3-1 onto the material surface to measure on the premise that the material code selected is right. Be sure that coupling is well and the symbol ((●)) is on. The reading on display is the measurement value.

6.4 The reading is held till a new measurement value is coming. The last value is held on the display till the power is off.

6.5 2 modes to turn off the power.

Manual off at any time by pressing the power key or Auto power off after about 10 minutes from last key operation.

7. MEASURING BY VELOCITY SETTING

7.1 Press the VEL key 3-12 and the display shows the velocity set last time.

7.2 How to measure its thickness by the velocity known?

The velocity can be changed by pressing the plus key or minus key to the value of known velocity. The increment is 10m/s every time when pressing the plus or minus key. And the increment is 100m/s if depressing the key for more than about 4 seconds.

7.3 Drop a little oil onto the material to measure and press the Sensor onto the surface. The reading on the display is the thickness if coupling well. So if we have known the velocity of a certain material, it is easy to measure the thickness by 7.2.

7.4 How to measure the thickness by a sample of known thickness?

Just get a sample of known thickness. Then repeat 7.2 and 7.3 till the measurement value is totally same as the known thickness. In such a case, the set value is the velocity of the material to measure, by which you can measure any unknown thickness of same material.

7.5 To browse the velocity, just press the VEL key 3-12. To quit browsing, VEL key 3-12. To quit browsing, just press the VEL key 3-12 again or wait till the meter automatically show '0'.

7.6 By use of velocity measurement, it is easy to measure the thickness of any hard materials.

8. TO MEASURE ITS VELOCITY BY THE THICKNESS KNOWN

8.1 Press the VEL key 3-12 for about 3 seconds, the display shows "H". Then release the key, the display shows a thickness. The thickness can be changed by pressing the plus key or minus key to

the value of known thickness.

8.2 Drop a little oil onto the material to measure and press the Sensor onto the surface. The stabilizing value on the display is the velocity if coupling well. The velocity will be automatically stored in cd12.

8.3 To quit, just press the VEL key 3-12 for about 3 seconds, the display shows "H". Then release it.

8.4 To measure unknown thickness of the same material, just press the VEL key 3-12 and the velocity saved will be recalled.

9. BATTERY REPLACEMENT

9.1 When the battery symbol appears on the display, it is time to replace the batteries.

9.2 Slide the Battery Cover away from the instrument and remove the batteries.

9.3 Install batteries paying careful attention to polarity.