
BACK PLUNGER TYPE DIGITAL INDICATORS








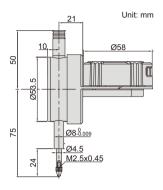

2118-10

spindle lift knob is included






warning when over tolerance





- Display can rotate 320°, and display direction is changeable
- Reading in digital and analog
- Button function: tolerance Go and No-Go display, data preset, measuring direction change, max./min./TIR measurement, inch/metric conversion, absolute/incremental measurement
- Keep preset data and tolerance data in memory after restart
- CR2032 battery, automatic power off (time is adjustable)
- Data output
- Optional accessory: data output cable (code 7315-50M, 7302-40M, 7305-40M), backs, contact points

display direction is changeable

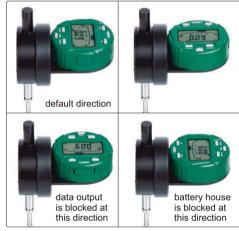

remark: to change above direction, 4 fixing screws on the back of display need to be removed first.

display can rotate 320°



| Code | Range | Resolution | Accuracy | Hysteresis | Remark |
|-----------|-------------|------------------|----------|------------|-----------|
| 2118-10 * | 12.7mm/0.5" | 0.01mm/0.0005" | 20µm | 10µm | flat back |
| 2118-101* | 12.7mm/0.5" | 0.001mm/0.00005" | 5µm | 2µm | flat back |

^{*}Supplied with manufacturer inspection certificate